





4414

■ Quick change toolposts

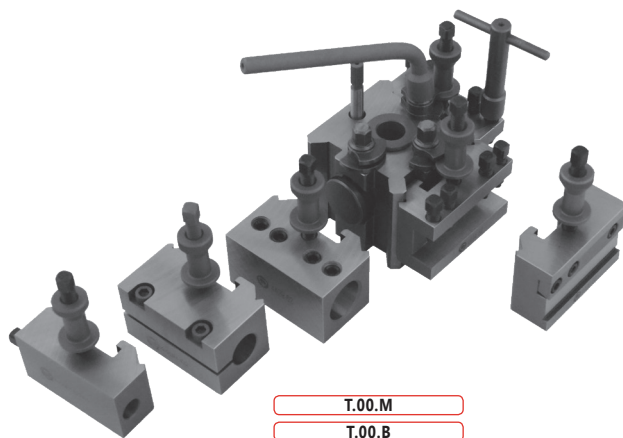

T.00.M
T.00.B
T.0

T.1
T.1.X
T.2
T.2.T
T.3
T.3.HX

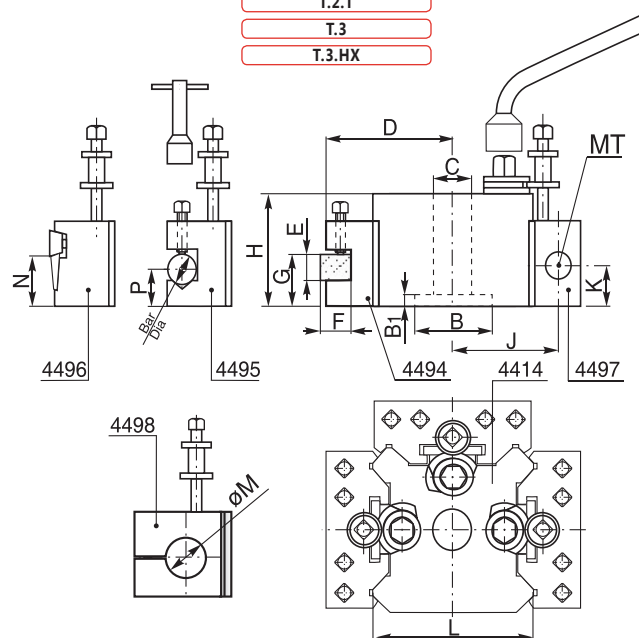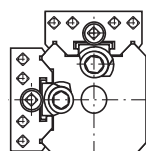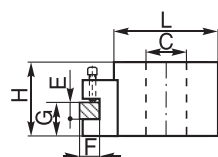

Size	H [mm]	B [mm]	B ₁ [mm]	C [mm]	D [mm]	E [mm]	F [mm]	G max. [mm]	G min. [mm]	Bar Dia [mm]	P max. [mm]	P min. [mm]	MT	J [mm]	K max. [mm]	K min. [mm]	L [mm]	N [mm]	M [mm]
T.00.M	37.0	—	—	11.2	50.0	12	11.0	27.0	17.0	11.0	22.5	12.5	—	—	—	—	58.0	16.0	—
T.00.B	42.0	—	—	16.0	50.0	12	11.0	32.0	17.0	11.0	27.5	12.5	—	—	—	—	58.0	16.0	—
T.0	51.0	22.22	12.5	19.0	62.0	16	13.0	36.5	20.5	16.0	32.0	16.0	1	52.5	28.5	16.0	73.0	27.0	19.0
T.1	63.5	31.75	8.5	19.0	62.0	20	13.0	46.0	30.0	16.0	44.5	25.5	1	52.5	41.0	22.0	73.0	27.0	19.0
T.1.X	73.0	31.75	8.5	19.0	62.0	20	13.0	57.0	35.0	16.0	54.0	32.0	1&2	52.5	51.0	28.5	73.0	27.0	19.0
T.2	71.5	44.45	9.5	25.5	74.5	20	19.0	52.5	36.5	19.0	46.0	24.0	2	65.0	47.5	27.0	97.0	33.5	25.4
T.2.T	76.0	44.45	9.5	25.5	84.0	25	25.5	58.5	39.5	19.0	50.0	24.0	2	70.0	51.0	27.0	106.0	33.5	25.4
T.3	95.5	50.80	11.5	25.5	101.5	32	25.5	74.5	51.0	25.5	51.0	28.5	3	85.5	58.2	36.5	125.5	39.5	38.0
T.3.HX	108.0	50.80	11.5	25.5	101.5	32	25.5	84.0	62.0	25.5	65.0	41.0	3	85.5	58.2	36.5	125.5	39.5	38.0